

Menu

HISTORY FILE MAP for year 2003

REALTIME


PLAYBACK

RECALLED REALTIME

RECALLED PLAYBACK

021.01:41-01:43 2m RT 2048bps data plus 9m PB
(020.10:29-10:38) 512bps data lost at DSS54. RT data
outage was close to DSU standby,
possibly leading to longer data gap.
No DR was raised.

023.08:14-08:27 13m RT 1024bps data lost due to incorrect bitrate
(022.15:26-21:11) selection on s/c causing long lock up at DSS14. As
2048pbs was selected instead of 4096bps, DSU continued
to playback after BRC to 1024bps RT rate. 5h46m of
512bps playback data lost. DR G102240 refers.

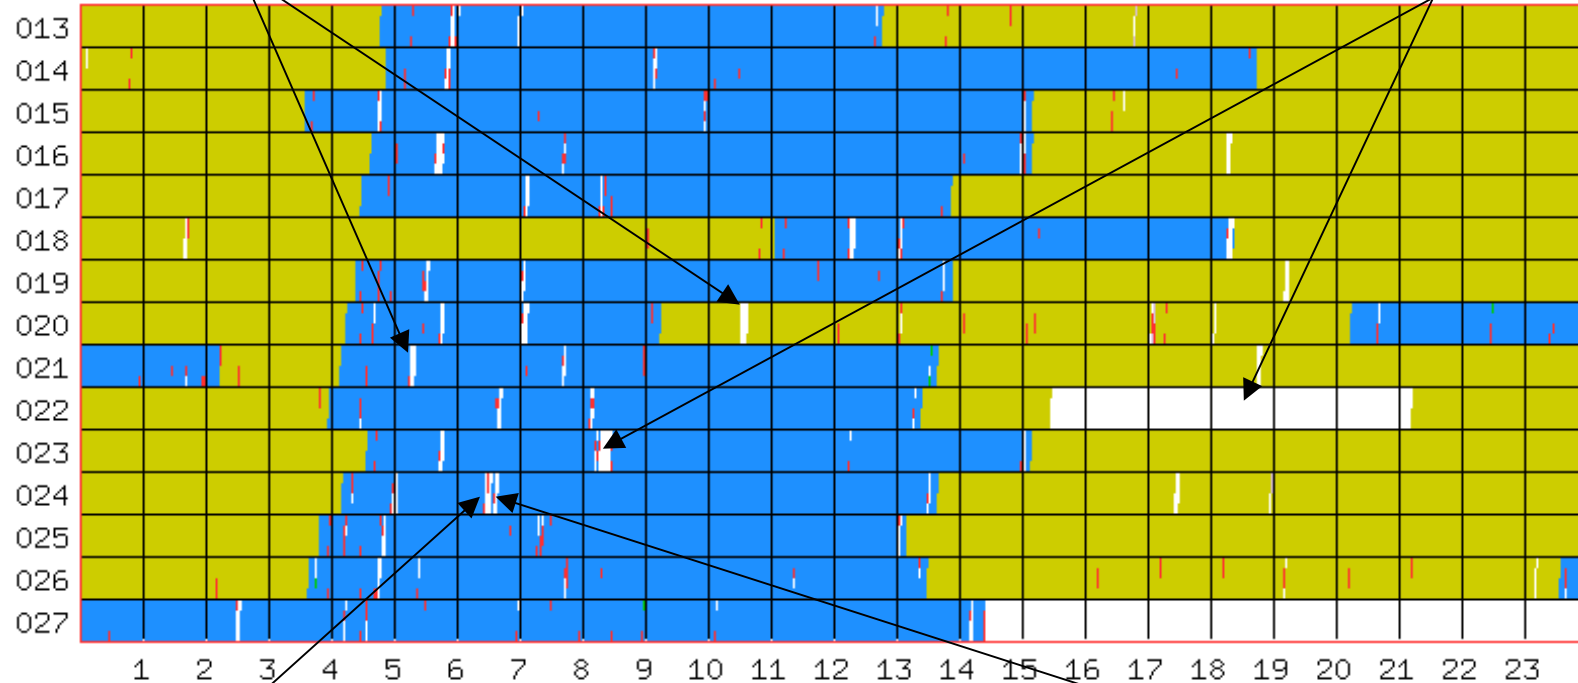

024.06:25-06:32 7m gap in RT 1024bps data due to 2-
way to 1-way transition closely followed
by BRC from 1024bps to 2048bps at
DSS14. No DR was raised.

024.06:35-06:39 5m RT data gap due to additional
bitrate change from 2048bps to
4096bps to recover missed PB data
from 03.023.